

KOMAX 43T

Error 2160

Unknown error I/O PCB 1 input 6 not active

- Re-gap sensor B1.6 to 0.5mm.
- Reseat cable sensor connection.
- Check DC voltage to sensor at point 29/30 of A1 wiring PCB for 3-13vdc.